

Work Order ID 151599

Monday, October 03, 2016 2:51:26 PM

151599

Page 1

Item ID: D350-748-243TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Installation, High Aft

Start Date: 10/3/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/10/2016 Req'd Qty: 1.00

1

Customer:

Reference:

DAS

21

9-89

Date: OCT 03 2016

Tooling:

Date:

Run Start ***NR1***

Approvals:

Process Plan:

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D350-748-243

A

100

0.00

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.30

Mori Seiki CNC Lathe Large

1-Cut tube on chop saw, leave extra mat'l for facing and install plugs 350-241 on both ends.

2-Face both sides of tube.

3- Turn program 02000 section on both side as per folio FB468.

4- Turn program 03000 section on both side as per folio FB468.

5- Blend transsition lines only with belt sander 60 grit

Folio rev: AA

Dwg rev: C

1 0 16/10/5

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control

1 0

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : ☐									

Work Order ID 151599

Monday, October 03, 2016 2:51:26 PM

151599

Page 2

Item ID: D350-748-243TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Installation, High Aft

Start Date: 10/3/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/10/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

0.00

120

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.49

Mori Seiki CNC Lathe Large

1- Turn program 04000 section on both side as per folio FB468.

2- Turn program 05000 section on both side as per folio FB468.

3- Blend transsition lines only with belt sander 60 grit

4-Scribe part # as per Dwg D350-748-243

Folio rev: AADwg rev: A

130

QC2- Inspect parts off machine FAI/FAIB

0.00

130

QC

Quality Control

Memo

0.00

PERFORME ULTRASONIC MEASURMENT

1 0

16/10/11

1 0

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 151599

Monday, October 03, 2016 2:51:26 PM

151599

Page 3

Item ID: D350-748-243TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Installation, High Aft

Start Date: 10/3/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 10/10/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00				1			
140									
QC	Memo	0.00							
Quality Control								16-10-17	
150	Large Fab	0.00							
150									
Crosstubes	Memo	0.20							
Crosstubes	1-Grind machining marks								
190	Packaging	0.00							
190									
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack								
	Location: <u>LG14</u>								

DPZ 16-10-24

DPZ 16-10-24

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Work Order ID 151599***151599***

Page 4

Monday, October 03, 2016 2:51:26 PM

Item ID: D350-748-243TRN**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Crosstube Installation, High Aft**Start Date:** 10/3/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 10/10/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2*****Sequence ID/
Work Center ID****Operation
Description****Set Up/
Run Hours****Tool ID****Tool #****Plan
Code****Accept
Qty****Reject
Qty****Reject
Number****Insp.
Stamp**

200

QC21- Final Inspection - Work Order Release

0.00

200

QC

Memo

0.20

Quality Control

16/10/24 [Signature]

16.10.24

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Monday, October 03, 2016 2:51:34 PM

Page 1

Work Order ID: 151599

151599

Parent Item: D350-748-243TRN

D350-748-243TRN

Parent Item Name: Crosstube Installation, High Aft

Start Date: 10/3/2016

Required Date: 10/10/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev: PRELIM New Issue LL 12.05.08

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6021-125

Manufactured No

Each

41.0000

1

D6021-125

Crosstube Material - 17-4Ph SS

Location

Loc Qty

Loc Code

HALL

25

127271

25

LG

16

127272

16

Handwritten signature and date 10/10/13

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

DART AEROSPACE LTD		Work Order:	151599
Description: Crosstube Assembly (AS350/355 High Aft SS)		Part Number:	D350-748-243
Inspection Dwg: D350-748-243 Rev: A		Page 1 of 2	

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments	
SIDE A	2.240	+/-0.005	2.245	✓		↑		
	2.180	+0.005/-0.000	2.184	✓				
	2.180	+0.005/-0.000	2.183	✓				
	2.208	+0.005/-0.000	2.212	✓				
	2.234	+0.005/-0.000	2.227	✓				
	2.253	+0.005/-0.000	2.255	✓				
	2.272	+0.005/-0.000	2.276	✓				
	2.299	+0.005/-0.000	2.297		✓		Vernier 08 Vernier 01	OK, JW
	0.063	+/-0.010	0.063	✓		↓		
	5.25	+/-0.060	5.25	✓				
	R0.063	+/-0.010	R0.063	✓				
	R0.50	+/-0.030	R0.500	✓			Vernier 08	
	SIDE B	2.240	+/-0.005	2.243	✓		↑	
		2.180	+0.005/-0.000	2.183	✓			
2.180		+0.005/-0.000	2.181	✓				
2.208		+0.005/-0.000	2.210	✓				
2.234		+0.005/-0.000	2.236	✓				
2.253		+0.005/-0.000	2.254	✓				
2.272		+0.005/-0.000	2.277	✓				
2.299		+0.005/-0.000	2.301	✓		Vernier 08		
0.063		+/-0.010	0.063	✓		↓		
5.25		+/-0.060	5.25	✓				
R0.063		+/-0.010	R0.063	✓				
R0.50		+/-0.030	R0.500	✓			Vernier 08	
		124.70	+/-0.060	124.70	✓		tape	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
QC / QA Coordinator Approval									

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐
Design ☐	☐	Operator	☐	Bending	☐	Set-up	☐
Doc/Data ☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐
Equip/Tooling ☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐
Handling/Pre ☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐
Material ☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐
Internal Transport ☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐
Tribal Knowledge ☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐
LOA ☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐
Substation ☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐
Past Expiry Date ☐	☐	Manufacturing Process	☐	OTHER : _____ _____ _____			
Misidentified ☐	☐	Past Due	☐				

DART AEROSPACE LTD		Work Order:	151599
Description: Crosstube Assembly (AS350/355 High Aft SS)		Part Number:	D350-748-243
Inspection Dwg: D350-748-243 Rev: A		Page 2 of 2	

WALL THICKNESS MEASUREMENT

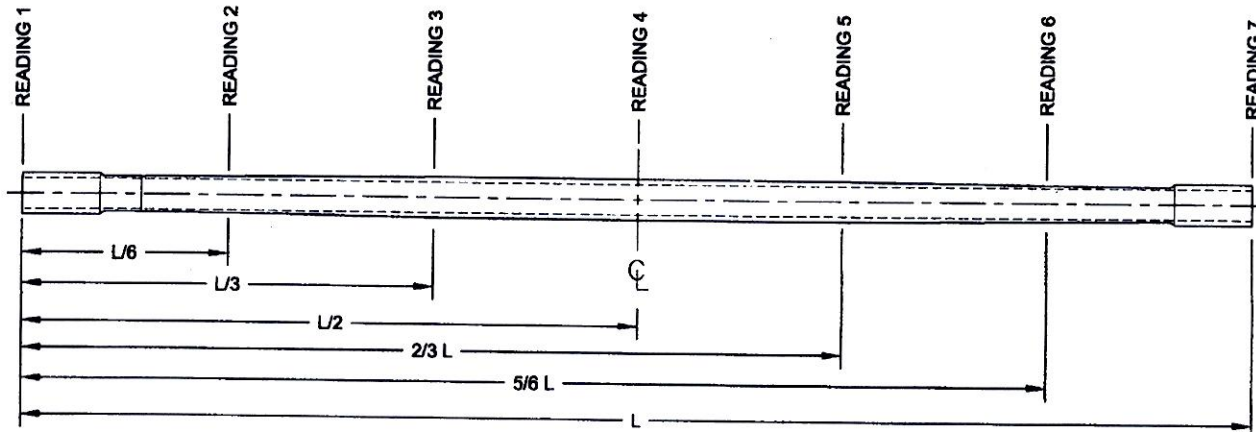

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.118	.125	.124	.120	0.007	0.030"
READING 2 L= 20.78	.113	.109	.108	.113	0.005	
READING 3 L= 41.57	.148	.150	.149	.148	0.002	
READING 4 L= 62.35	.146	.148	.150	.151	0.005	
READING 5 L= 83.13	.143	.143	.150	.134	0.011	
READING 6 L= 103.92	.108	.108	.112	.113	0.005	
READING 7 L= 124.70	.121	.120	.121	.120	0.001	

Calibration Result

Actual Block Thickness: 100-4500

SITESCAN 250 Measured Thickness: 100-4300

DAS
47

Measured by:	<i>[Signature]</i>
Date:	16/10/17

Audited by:	9-89
Date:	16/10/17

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised By	Approved
A	15.09.09	New Issue (P/O D350-748-203)	KJ <i>[Signature]</i>	<i>[Signature]</i>

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

Item	Qty	Part Number	Description
	-243		
1	X	D350-748-243	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
2	1	D6021-125	CROSSTUBE
3	2	D3502-1	SUPPORT
4	2	D5123-7	CLAMP CUSHION
5	1	AETC-1032	INSERT
6	2	MS21920-20 OR MS21920-21/-22	CLAMP (PER DART SPEC. M-MS21920-20/-21/-22)
7	1	NAS1149C0363R	WASHER (OR AN960C10)
8	1	NAS1635-3-8	SCREW (OR MS51958-63)
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6021-125
FINISHED LENGTH AFTER TURNING = 124.70±0.06 (AFTER BENDING/TRIMMING = 122.70 REF)
- 2) FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER "D350-748-243" AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 29.85 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.290 HOLE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

TURNING

- 10) BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.

BENDING

- 11) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. ON TOP HALF OF BEND, AND 8% ON BOTTOM HALF OF BEND.
- 12) MAX AMPLITUDE OF RIBBLING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- 13) MAX TWIST: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

ASSEMBLY

- 14) TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 60 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 151599 MJS
1610-03

DEO ATTACHED

RELEASED

2015 MAR 18

RELEASED

2015 MAR 18

UNDER REVIEW

15/4/15


15/5/15

OK

16/12/15

A	NEW ISSUE	CP	15.01.21
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	15.01.21		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D350-748-243	REV. A SHEET 1 OF 4
TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE NTS
COPYRIGHT © 2015 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

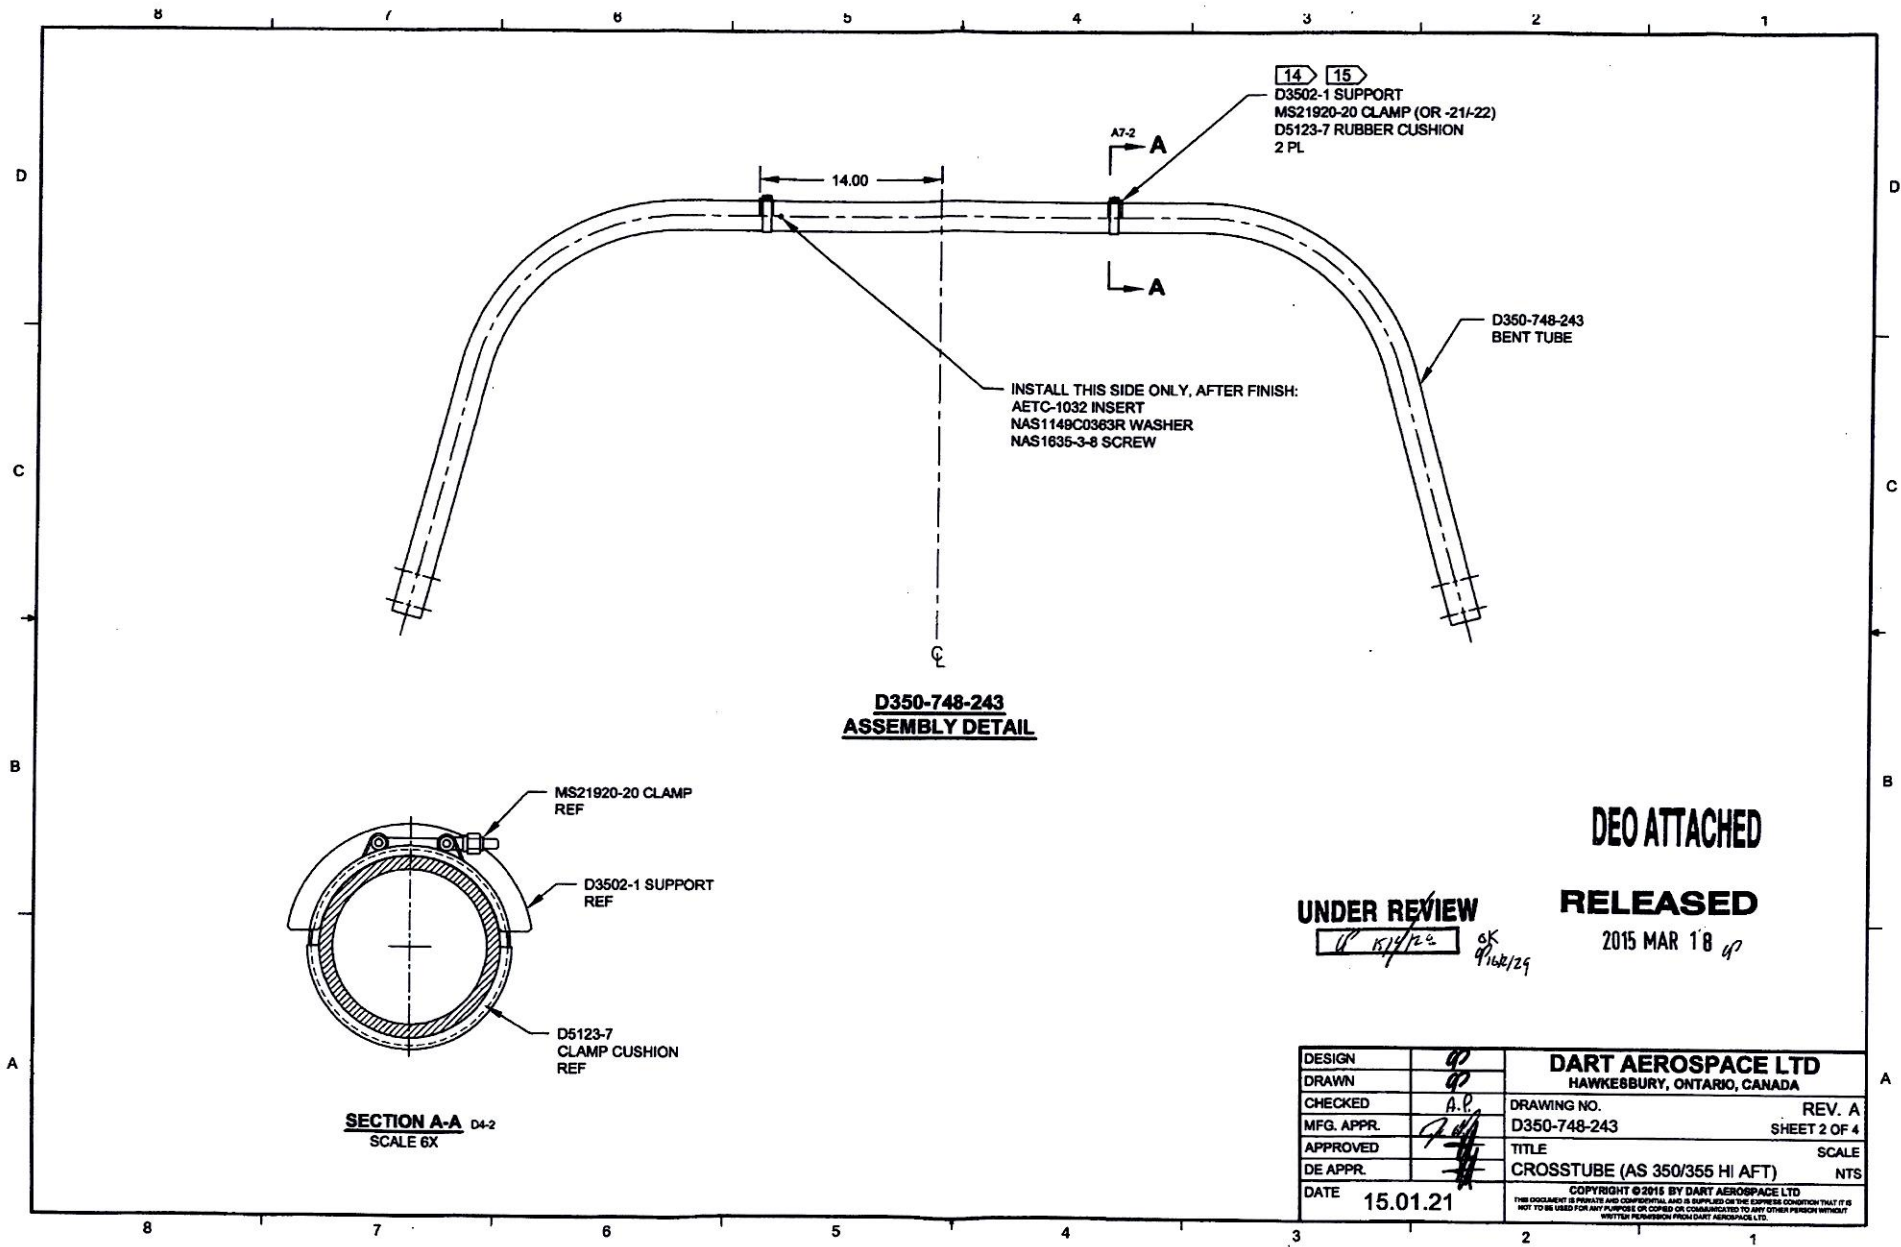

DEO ATTACHED


RELEASED

UNDER REVIEW


OK 15/1/20 9/16/29

2015 MAR 18 47

DESIGN	92	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	92		
CHECKED	A.P.	DRAWING NO.	REV. A
MFG. APPR.	7/1/20	D350-748-243	SHEET 2 OF 4
APPROVED	7/1/20	TITLE	SCALE
DE APPR.	7/1/20	CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

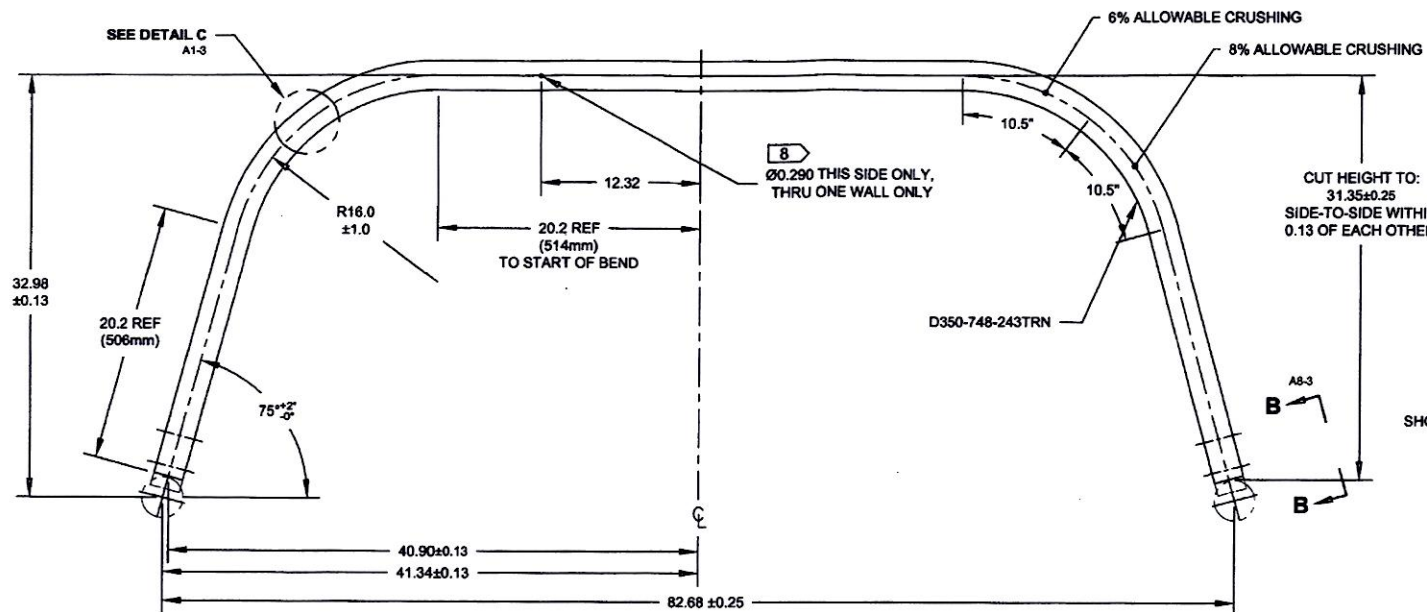

D350-748-243
BENDING AND DRILLING DETAIL 11

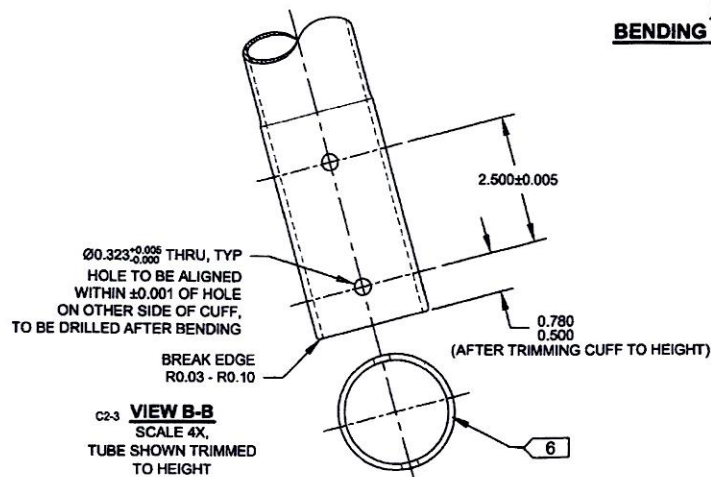


DEO ATTACHED
RELEASED

2015 MAR 18


UNDER REVIEW

15/1/21 OK 9/6/21

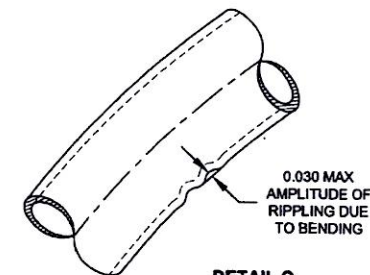

DETAIL C 07-3
SCALE 4X
RIPPING EXAGGERATED

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. A
MFG. APPR.		D350-748-243	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

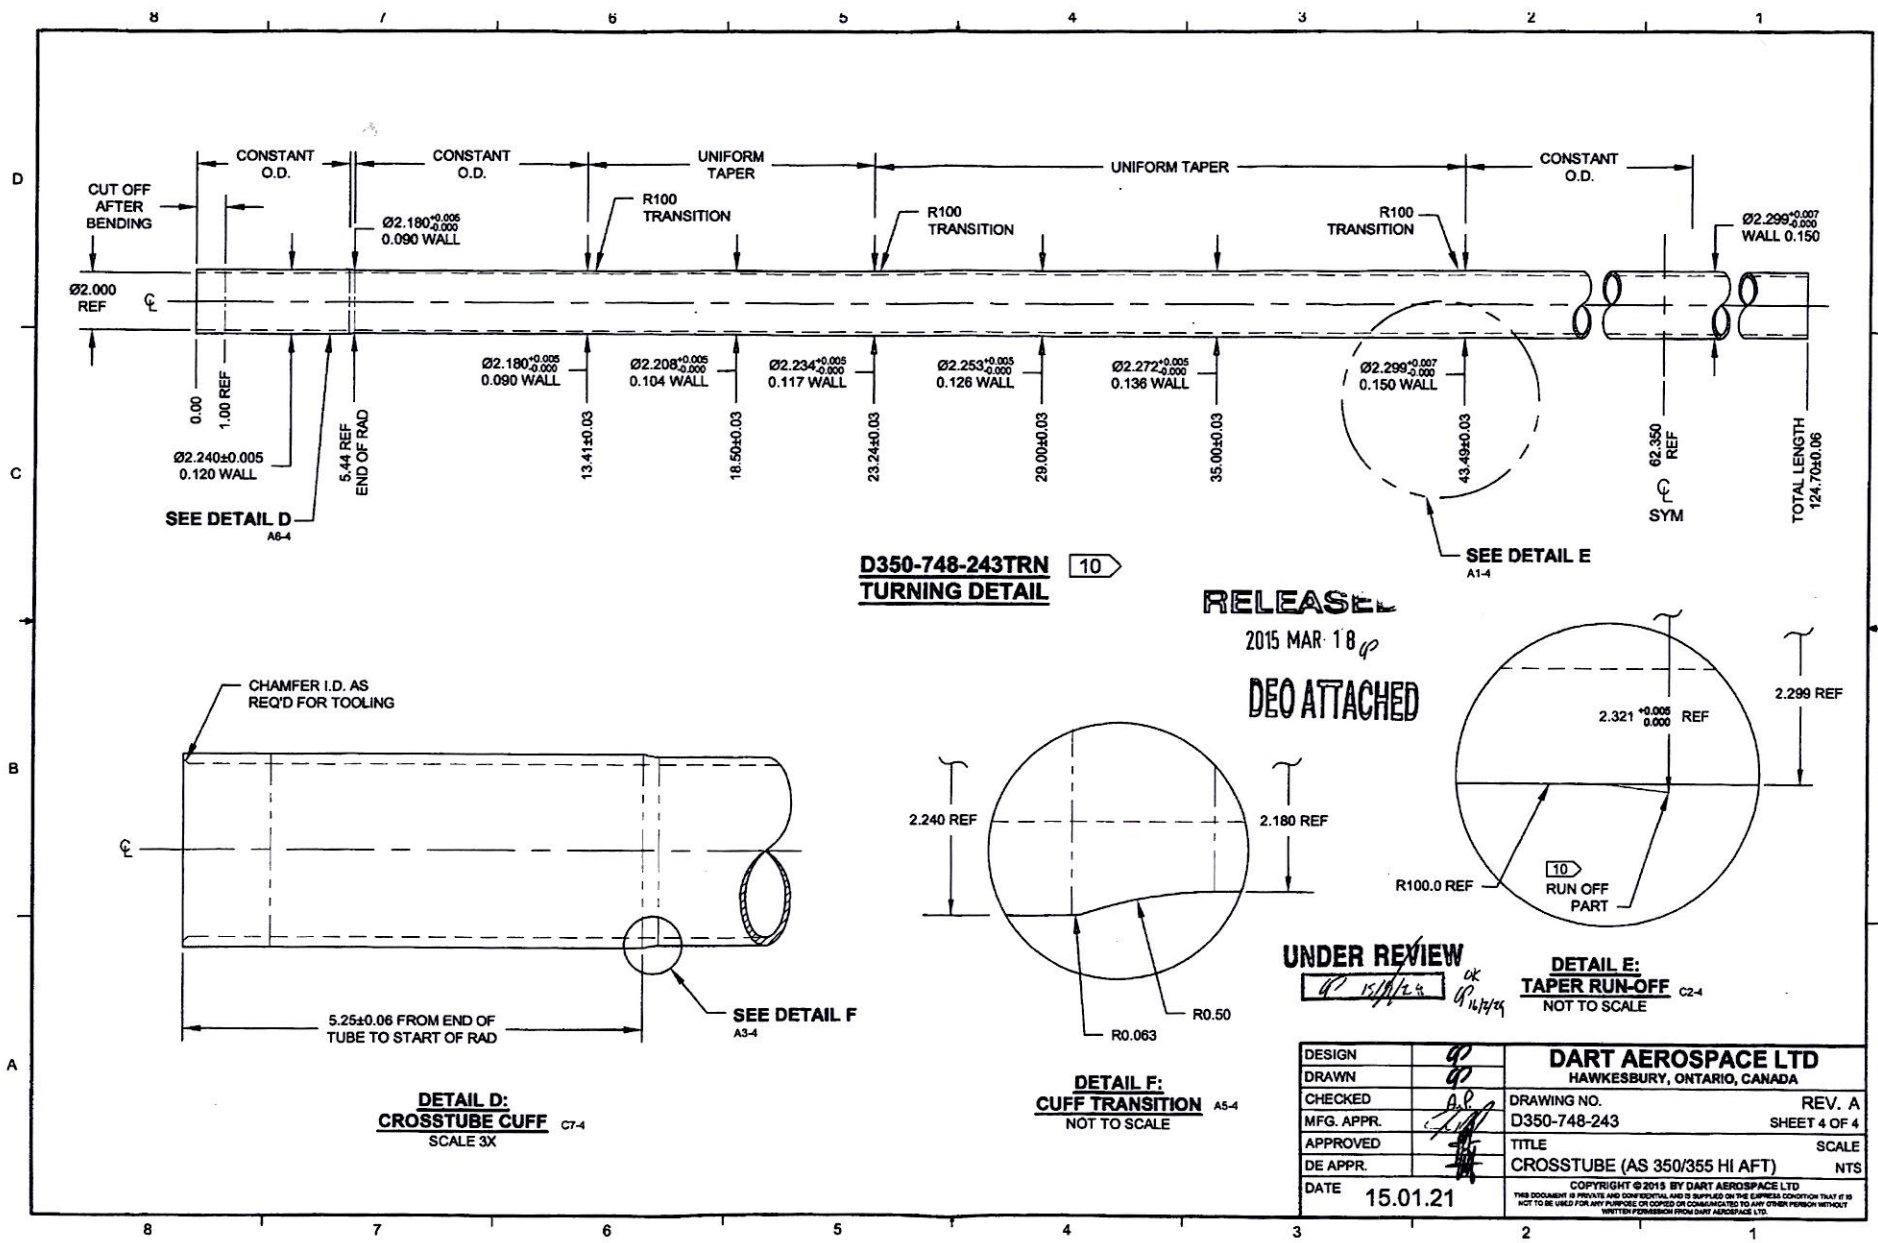

DRAWING NO. D350-748-243	TITLE CROSSTUBE	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D350-748-243-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>qp</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 15.11.18	DATE 15.11.18	DATE 16.02.19	DATE FEB 19 2016		DATE 2016.02.19		

AMEND NOTE 2 (SHEET 1) AS FOLLOWS:

- 2) FINISH: PREPARE SURFACE PER DART QSI 005 4.1.4
 PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
 PAINT OUTSIDE PER DART QSI 005 4.2
 OR
 POWDER COAT WHITE (4.3.5.2) PER DART QSI 005 4.3

RELEASED
 2016-02-26
 EN 16-534 *[Signature]*

COPYRIGHT © 2015 BY DART AEROSPACE LTD
 THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
 NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
 WRITTEN PERMISSION FROM DART AEROSPACE LTD.